

Technical Information

GL18

Glaze Catalogue

In this Technical Information bulletin we are introducing a selection of glazes for earthenware, tableware and art ceramics, stove tiles and stoneware.

Additionally, several useful specialty frits for glaze corrections are listed.

A catalogue with the most common glaze defects is provided as well.

At the end of this bulletin, a table with the glaze properties is given.

The here mentioned glazes and frits resemble only a small selection of our complete product range. Please let us know if your desired glaze is not included.

For assistance in selecting and adapting your glazes, please call our technical service department.

Content

Transparent glazes, lead free	p. 2
Bone china and vitreous china glazes	p. 5
Transparent glazes, lead containing	p. 6
Matt glazes	p. 8
Opaque glazes	p. 10
Effect and oversaturation glazes	p. 11
Stoneware glazes	p. 14
Special frits	p. 16
Glaze defects	p. 17
Glaze properties	p. 19

Transparent Glazes, Lead Free



VTR 40 539 F

transparent, glossy
temperature range: 1040 to 1100 °C

The glaze VTR 40 539 F is a universally suitable glaze for earthenware, tableware and art ceramics.

It develops colours well, including pink stains (CaSnSiCr) and inclusion pigments, also with colouring oxides. Granulated glazes and stains can be stirred in.

Dark colours show nice effects with the glitter pigment 268 300. Interesting crystalline eliminations can be achieved with the addition of 248 030 (0.6 to 2.0 g for 100 g of glaze).



VTR 166

transparent, glossy
temperature range: 1040 to 1100 °C

The glaze VTR 166 is an economic alternative to the glaze VTR 40 539 F, but more viscous.

It shows a good development of colours as well with almost all stains and inclusion pigments, but only limited with cobalt aluminate blue and not with pink (CaSnSiCr).

Specialty: together with the glaze 40 660 F or the frit 90 710, good results are obtained for the inclusion pigments 270 547 and 270 548.



VTR 40 660 F

transparent, glossy glaze for inclusion pigments
temperature range: 1000 to 1150 °C

The glaze VTR 40 660 F is suitable for traditional inclusion pigments. Together with the glaze VTR 166 it shows also with the two inclusion pigments 270 547 and 270 548 a good transparency and excellent colour development. The best blend for this purpose is 30 % 40 660 F and 70 % VTR 166.

The stain addition should be 8 to 10 g for 100 g of glaze.



VTR 320

transparent, glossy
especially low temperature range: 920 to 980 °C

The colour development of this glaze is good, although at 920 °C it reaches its limits.

The glaze VTR 320 is only partially suitable for the inclusion pigments 270 547 and 270 548. Pink stains (CaSnSiCr) turn brown.

**VTR 102**

transparent, glossy

temperature range: 980 to 1070°C

The glaze VTR 102 is a soft glaze for earthenware, tableware and art ceramics. It can be blended especially well with the glaze VTR 166, with a recommended ratio of 30:70.

The colour development is excellent with all stains, especially in the low temperature range.

VTR 102 is recommended for **pink stains** (CaSnSiCr). It is not suitable for CoAl blue and has only limited suitability for cobalt silicate blue and the inclusion pigments 270 547 and 270 548.

**VTR 209**

transparent, glossy

temperature range: 980 to 1050 °C

The glaze VTR 209 is a soft earthenware glaze. Together with the glaze VTR 105 it can also be used for stove tiles.

It shows a good colour development with blue and yellow triaxial stains (ZrSiV, ZrSiPr) and CoSi blue, especially at 980 to 1030 °C.

By blending it with the glaze VTR 105 in a ratio of 30:70, the temperature range can be expanded to 1100 °C. Then even inclusion pigments may be used.

Specialty: the addition of 2 to 4 g zinc oxide to 100 g of glaze, the gloss is enhanced and the surface looks brilliant.

**VTR 40 271 TM**

transparent, glossy

temperature range: 1060 to 1100 °C

The glaze VTR 40 271 TM is the **best choice for pink stains**. It is suitable for earthenware, tableware and stove tiles.

The colour development of stains is good, but not with colouring oxides.

Specialty: The addition of 6 to 8 g alumina to 100 g of glaze results in a matt glaze that may be coloured with all kinds of stains.



VTR 105

transparent, glossy

temperature range: 1040 to 1100 °C

The glaze VTR 105 is a viscous glaze for earthenware, stoneware and stove tiles.

It is especially suitable for ZrSiV and ZrSiPr stains, as well as for CdSSe inclusion pigments and CoAl blue. It may not be used for pink (CaSnSiCr) and CoSi blue.

By adding the glaze VTR 209, the temperature can be lowered to 1000 °C. The surface then appears a lot glossier and more evenly. A mixing ratio of 70:30 is recommended.

Specialty: the addition of 15 g zircon silicate to 100 g of the blend of VTR 105 and VTR 209 results in a glossy, opaque white.

Specialty: The glaze VTR 105 may be used in economic matt glazes, depending on the temperature for earthenware, stove tiles or stoneware.

Examples:

1040 °C: 70 % base mixture, 30 % VTR 105

1100 °C: 85 % base mixture, 15 % VTR 105

1180 °C: 95 % base mixture, 5 % VTR 105

The firing temperature and/or change in the ratio base mixture to VTR 105 triggers the desired degree of matt surface appearance.

Base mixture for the blend with VTR 105:

dolomite	50
zinc oxide, lead free	115
calc spar	120
nepheline syenite	138
sodium feldspar	150
kaolin	142
silica	285

All glaze combinations develop stains well, up to 1140 °C also 270 547 and 270 548.

Up to 1100 °C, nice, partially crystalline effects are created by the addition 2 g 248 030 and 20 g of the granulate 50 559 GY to 100 g of glaze.

Bone China and Vitreous China Glazes



DV 14214A and DV 14214B

transparent, glossy, lead free
temperature range: 1040 to 1120 °C

These glazes are usable for underglaze and for onglaze decoration.

Both glazes have limited suitability for colour stains. They may not be used for pink stains.

The glaze DV 14214A is excellent for the inclusion pigments 270 547 and 270 548.

DV 14215A, DV 14215B

transparent, glossy, lead free
temperature range: 1040 to 1120 °C

Both glazes may be used for underglaze and onglaze decoration.

The glaze DV 14215A is a very glossy, low viscous glaze, that flows already at 1120 °C.

Good and stable colourings with stains are possible up to 1080 °C, although pink turns brown.

The glaze DV 14215B is much more viscous than the glaze DV 14215A. The use of stains in the glaze DV 14215B is very limited.

Transparent Glazes, Lead Containing



VTR 40 5245 F

transparent, glossy

PbO 14 weight %

temperature range: 1040 to 1080 °C

The glaze VTR 40 5245 F is universally suitable transparent glaze for earthenware, art ceramics and stove tiles.

It is especially suitable for raw bodies in gas kilns. With stains and colouring oxides it shows a good colour development. Granulated glazes and stains may be stirred in.

In combination with dark colours, the glitter pigment 268 300 creates nice effects.



VTR 40 134 F

transparent, glossy

PbO 39 weight %

temperature range: 950 to 1040 °C

The glaze VTR 40 134 F is a typical glaze for **pink stains**. It can be easily coloured with stains, especially with pink (CaSnSiCr).

VTR 40 134 F is a perfect choice in underglaze painting.



VTR 17

transparent, glossy

PbO 43 weight %

temperature range: 950 to 1040 °C

The glaze VTR 17 is usable for art ceramics and stove tiles, especially for raw bodies.

It may be coloured with stains and oxides, but not with pink (CaSnSiCr).

The colour development in a gas kiln is better than in the electrical kiln.



VTR 39

transparent, glossy

PbO 2 weight %

temperature range: 980 to 1020 °C

The glaze VTR 39 is suitable for earthenware and art ceramics.

It may be coloured with stains, except with pink.



VTR 40 610 F

transparent, glossy

PbO 43 weight %

temperature range: 1000 to 1150 °C

The glaze VTR 40 610 F is a very glossy, brilliant glaze for inclusion pigments.

It is suitable for earthenware, art ceramics, stove tiles and stoneware.

The glaze develops all kinds of inclusion pigments well.

Matt Glazes



VTR 40 525 F

matt, colourless, lead free
temperature range: 1020 to 1100 °C

The glaze 40 525 F is a universally suitable matt glaze for earthenware, tableware, art ceramics and stove tiles.

It develops colour stains nicely, even pink (CaSnSiCr) and all inclusion pigments. Additionally, granulated glazes and stains may be used.

In the upper temperature range (1080 to 1120 °C) the surface is silk-matt.

Specialty: the addition of 15 % zircon silicate results in a smooth, white matt surface.



VTR 40 545 TM

colourless, silk-matt, lead free
temperature range: 1020 to 1080 °C

The glaze 40 545 TM is a **matt basic glaze for effect-building components**, suitable for earthenware, art ceramics and stove tiles.

It is perfect for colour stains.

Interesting oversaturation effects are created by the addition of all kinds of granulated glazes, stains and frits. These effects are enhanced by additions of 248 030, 238 512 or 298 026.



VTR 40 287 TM

matt, colourless, lead free
temperature range: 1040 to 1120 °C

The glaze 40 287 TM is a matt glaze for stove tiles and art ceramics.

It is not suitable for stains, but develops nice rustic effects with oxides and granular frits.

Specialty: Mixtures with the glaze 40 271 TM (50:50) result in a soft, silk-matt glaze, that can be coloured universally. Granulated glazes, stains and frits may be stirred in as pleases.



VTR 105 with raw material mixture

silk-matt to stone matt, colourless, lead free

temperature range: 1040 to 1180 °C

The glaze VTR 105 can be used as a component of economic matt glazes, which are suitable for earthenware, stove tiles or stoneware, depending on the temperature.

Examples:

1040 °C: 70 % base mixture, 30 % VTR 105

1100 °C: 85 % base mixture, 15 % VTR 105

1180 °C: 95 % base mixture, 5 % VTR 105

The firing temperature and/or change in the ratio base mixture to VTR 105 triggers the desired degree of matt surface appearance.

Base mixture for the blend with VTR 105:

dolomite	50
zinc oxide, lead free	115
calc spar	120
nepheline syenite	138
sodium feldspar	150
kaolin	142
silica	285

All glaze combinations develop stains well, up to 1140 °C also 270 547 and 270 548.

Up to 1100 °C, nice, partially crystalline effects are created by the addition 2 g 248 030 and 20 g of the granulate 50 559 GY to 100 g of glaze.



FCM 61094

white matt, lead containing

PbO 19 weight %

temperature range: 1040 to 1100 °C

FCM 61094 is a matt glaze especially suitable for stove tiles.

It can be decorated excellently with SKY100 decorating colours and is ideal for the engobe painting on relief patterns (wiping technique).

Opaque Glazes



VBC 49 7654

opaque, glossy, lead free

temperature range: 980 to 1050 °C

The glaze VBC 49 7654 is ideal for majolica painting on tableware.



VBC 13

opaque, glossy, lead free

temperature range: 980 to 1060 °C

The glaze VBC 13 is suitable for earthenware, tableware and art ceramics.

It fires well on raw bodies in gas kilns.

At firing temperatures higher than 1020 °C it may be used for majolica painting.



VBC 142

opaque, glossy, lead free

especially low temperature range: 920 to 980 °C

The glaze VBC 142 is designed for onglaze decoration.

Effect and Oversaturation Glazes




VBC 43 554 TM

beige, silk-matt, low degree of crystalline eliminations, lead free
temperature range: 1020 to 1140 °C

The glaze VBC 43 554 TM is ideal for earthenware, stove tiles and art ceramics.

It can be coloured with stains and is suitable for granulates.

The addition of 248 030 and 298 026 enhances the effects.

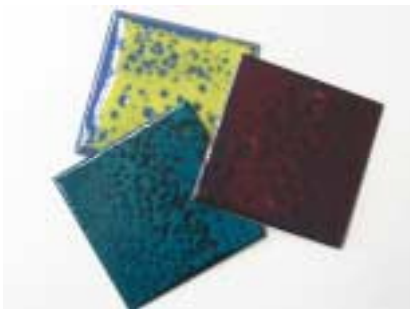

VBC 43 556 TF

beige, slight silk-matt effects, lead free
temperature range: 1020 to 1080 °C

The glaze VBC 43 556 TF is a versatile earthenware glaze, ideal also for stove tiles.

The colouring with stains is limited, but the colouring with frits and oxides is possible.

The addition of all kinds of granitis enhances the oversaturation effects. 248 030, 238 512 and/or 298 026 also show interesting effects.

Specialty: the use of a base glaze 43 556 TF, coloured with stains, together with a top glaze of VTR 166 with 40 660 F or of 40 539 F, also coloured with oxides, creates a very interesting appearance.



Example 1

Base glaze:		Top glaze:	
43 556 TF	100	VTR 166	70
240 942	8	40 660 TF	30
		270 548	8


The red is very similar to a selenium red, but this special effect cannot be achieved with a selenium glaze.

Example 2

Base glaze:		Top glaze:	
43 556 TF	100	40 539 F	100
220 946	5	270 968	15

The base glaze may preferably be coloured dark. The top glaze may be coloured as pleases, but preferentially in contrasting colours to the base glaze.

Fine or strong effects are created when using different layer thicknesses of base and/or top glaze. They can be adjusted individually according to demand.

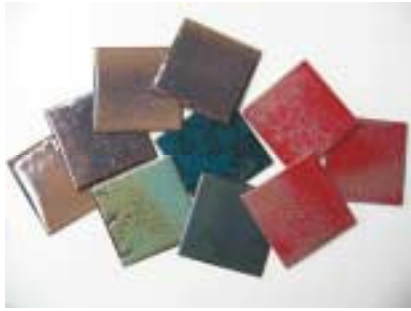

VBC 46 233 TM

iron aventurine glaze, brown, lead free
temperature range: 980 to 1100 °C

This is a crystalline aventurine glaze for earthenware, stove tiles and art ceramics.

It looks very elegant as a decoration glaze on top of anthracite or strongly coloured, viscous glazes.

Specialty: with the base glaze 46 233 TM, appealing crystalline effects can be created.



Example 1			
Base glaze:		Top glaze:	
46 233 TM	100	VTR 166	70
		40 660 TF	30
		270 548	8

Depending on the layer thickness of the base or top glaze, the effects are changing from small crystalline stars to fine eliminations.

The red is very similar to a selenium red, but this special effect cannot be achieved with a selenium glaze.



Example 2			
Base glaze:		Top glaze:	
46 233 TM	100	40 539 F	100
		210 946	8

It is very beautiful if the top glaze is coloured with a strong contrast to the aventurine glaze.

It is also valid here that the degree of effects depends on the layer thickness of base and top glaze. They can be adjusted according to the individual needs.



VBC 49 485 TM

opaque, silk-matt to matt, lead free
temperature range: 1000 to 1100 °C

The glaze VBC 49 485 TM is suitable for earthenware, tableware, stove tiles and art ceramics.

Specialty: by gentle stirring, the glaze shows large-area glossy eliminations. The longer the glaze is milled, the finer and more matt the effects are.

The glaze is perfectly suitable for the colouring with metal frits and/or oxides, which cause elegant, slightly iridescent surfaces.



Example:	
49 485 TM	100
220 946	1

Colourings with stains appear as pastel shades, but develop vivid effects together with granulates.



VBC 49 872 TM

opaque, silk-matt, lead free

temperature range: 1000 to 1080 °C

This is a silky-elegant effect glaze for earthenware, stove tiles and art ceramics.

The glaze is suitable for creating pastel shades by the use of colour stains.

A surface refinement is achieved by the addition of 2 % 248 030.

Granitis enhance the eliminations significantly.

Example for a very elegant surface:



49 872 TM	100
248 030	2
zircon silicate	8
Stir into the glaze slip:	
50 559 GY	15
59 568 GY	15

Stoneware Glazes



VTR 40 581 E

transparent, glossy, lead free
temperature range: normal firing 1190 to 1250 °C,
fast firing 1260 °C (4 hours)

The glaze VTR 40 581 E is a versatile stoneware glaze, easy to colour with stains, with high brilliance and perfectly suitable for tableware.

The addition of granitis, 268 300 and/or 248 030 results in nice effects. Blended with 10 % aluminium oxide, a colourless matt glaze is obtained, whereas 15 % zircon silicate create a glossy white glaze.

Specialty: the addition of 5 to 15 % of the frit FTR 90 023 F lower the melting point of the glaze VTR 40 581 F to 1140 to 1180 °C.



Crystals

The glaze 40 581 E as base glaze in combination with a top glaze and with 248 030 develops crystals of different sizes.

Example:

Base glaze:

40 581 E, with zircon and stains

Top glaze:

kaolin	103
238 495	103
lithium carbonate	52
zinc oxide, lead free	52
alumina	31
FTR 90 564 M	175
FTR 90 5158 M	484

When adding 1 to 2 % of 248 030 to the top glaze, interesting „dissolutions“ and crystalline effects are created. The addition of 3 to 5 % of 248 030 to the top glaze cause the formation of crystals.

The size and intensity of the crystals can be influenced by the quantity of 248 030 added to the top glaze and/or by the layer thickness of the top glaze. Depending on the body and on the firing conditions, the effects have to be adjusted individually.

**VTRS 115**

transparent, glossy, lead free
temperature range: 1150 to 1200 °C

The glaze VTRS 115 is a basic glaze for stoneware, for fired and for raw bodies.

It is well suitable for ZrSiV and ZrSiPr stains and common inclusion pigments.

**VTRS 115 with raw material mixture and FTR 90 564 M**

temperature range: 1150 to 1220 °C

Different blending ratios show a fired surface from matt to glossy.

Slight effects may be combined with all kinds of stains.

270 547 and 270 548 develop nicely in the glossy version up to 1180 °C.

**Examples:****glossy:**

VTRS 115	25
FTR 90564 M	17
raw material mixture	58

matt:

VTRS 115	15
FTR 90 564 M	23
raw material mixture	62

strongly matt:

VTRS 115	5
FTR 90 564 M	10
raw material mixture	85

Raw material mixture for the glaze VTRS 115:

238 495	99
zinc oxide, lead free	123
silica	148
kaolin	173
calc spar	210
sodium feldspar	247

The addition of 2 % 248 030 to the blends shows slight crystalline eliminations in the case of the glossy version and interesting eliminations in the matt versions.

The exchange of the more viscous frit 90 564 with the frit 11.37048.09 is possible. The eliminations are then decreased or totally avoided. The firing temperature may then be increased to 1250 °C.

Special Frits

FTR 90 167	lead free; frit with a c.t.e. of 150 ($\cdot 10^{-7}/K$); for correction of chipping	
FTR 90 255	lead free; frit with a c.t.e. of 40 ($\cdot 10^{-7}/K$); for correction of hair cracks	
FTR 90 710	lead free; an alternative to lead frits (up to 30 % lead); in combination with kaolin and silica suitable as a top coat for traditional firing; for earthenware and tableware	
FTR 90 427	lead free; lithium frit; for correction of surface tension; causes effects and crystals; for earthenware and stoneware	
FTR 90 428	lead free; together with the frit FTR 90 420 used as a base for effect glazes; for earthenware	
FTR 90 420	lead free; ZnBa frit, base for matt elimination glazes; for earthenware	
FTR 90 368	lead free; base for calcium containing glazes; for earthenware and tableware	
FTR 90 564	lead free; barium frit; to be used instead of barium silicate; causes effects; for earthenware and stoneware	
11.37048.09	lead free; barium frit; more viscous than the frit 90 564; for stoneware	
FTR 90 023	lead free; frit for lowering the melting point of the glaze VTR 40 581 E; for stoneware	
FBC 119 FTR 109	lead free base frits for craquelling glazes; for earthenware basic recipe:	
	FBC 119	85
	FTR 109	10
	zinc oxide, lead free	4
	bentonite	1



Glaze Defects

Why do glaze defects occur? In the following chapter the most common defects and hints to avoid them are given.

Overfiring or Underfiring

The most common reasons for glaze defects are underfiring or overfiring.

Underfiring causes a dry, scratchy surface. Often this can be cured by a second firing at a higher temperature.

Overfiring causes the glaze to flow. The glaze is then thinner at the top and thicker at the bottom. Sometimes it even drops from the body. Strongly overfired ceramics may also show pinholes and pitting, if the glaze reaches its evaporation temperature. Overfiring cannot be corrected.

Differing Coefficients of Thermal Expansion

The body and the glaze may have very different coefficients of thermal expansion (c.t.e.). If the c.t.e. of the glaze is too high, it might lead to the formation of cracks. If it is too low, it might cause chipping.

A too low c.t.e. might be adjusted by adding 2 to 7 % of the frit 90 167. If the c.t.e. is too high, 5 to 10 % of the frit 90 255 might correct this.

Application Problems and Adhesion of the Unfired Glaze

Wrong application of the glaze is the reason for several glaze defects. A too thin application might result in rough surfaces and also influence the glaze colour. A glaze application that is too thick promotes running and blistering. Uneven application causes stains and stripes, in the colour as well as in the surface structure.

Mistakes during application also influence the adhesion of the glaze to the body. The body must be clean and dry before the glaze is applied. If a second glaze should be applied on top, the first must be dried completely before doing so. Adhesion problems often cause a rolling off of the glaze.

Adhesion problems might be avoided by testing the glaze slip before application. The weight per litre and the viscosity should be measured. To keep the glaze slip from settling, a suspending agent should be used. When glazing raw bodies, adhesive should always be used.

Hair Cracks, Chipping and Peeling

Hair crack formation means the formation of a network of finer or thicker cracks in the fired glaze, sometimes directly after firing, sometimes later. Except in some special glazes, the formation of cracks is not desired.

There are several reasons for the formation of hair cracks. Normally cracks are occurring if the coefficient of thermal expansion of the glaze is too high. Due to the tension during cooling the glaze is crazing. The addition of the frit 90 255 and/or kaolin might help.

Cracks can also be caused by thermal shock due to a too fast temperature change. Longer soaking times and slower cooling help to avoid these cracks. A thinner layer of glaze or the addition of silica to the body are also advantageous.

In case of porous bodies with unglazed areas, moisture might be absorbed, which may lead to an expansion of the body. Then the body should be fired at a higher temperature or more calc spar should be added to the body.

Peeling and chipping is caused by a glaze c.t.e. that is too low. In this case the frit 90 167 should be added to the glaze.

Firing at lower temperatures and faster cooling could help. Perhaps also the feldspar and/or clay content of the body may be increased.

Very important is the formation of a good intermediate layer, that means the adhesion of the glaze to the body. A good intermediate layer is able to equalize the tension between glaze and body. Longer firing cycles and a sufficient soaking time enhance the formation of the intermediate layer.

Rolling off or Contraction of the Glaze after Firing

When rolling off or contracting, the glaze leaves empty areas on the body after firing.

Rolling off occurs if the glaze is not sticking to the body correctly. This might be the case if the body was not completely free of grease, dirt or moisture, or if the surface of the body is too smooth. Also a too thick layer of glaze can cause adhesion problems. Sometimes a glaze that is milled too fine can be the reason for rolling off.

Rolling off also occurs if the raw glaze was not dried long enough.

Too much opacifier may also lead to rolling off. Matt glazes with a high content of clay tend to rolling off, like too viscous glazes do.

If the surface tension is too high, the glazes might contract to droplets. This can be cured by additions of lithium, alkali or lead, which lower the surface tension.

Blistering and Pinholes

Blisters and pinholes are often formed by evaporating gas from the body or from the glaze while melting during the firing.

In most cases the outgassing process leaves enough time for the glaze to flow back and form an even surface. If there is too much gas or the glaze is too viscous, the glaze might solidify although the gas has not evaporated completely. After firing, blisters and pinholes remain.

Outgassing may have different reasons. Air in the body is often already formed during processing or due to the degradation of finished body material. In order to reduce air bubbles in the body, opening materials can be used.

In the glaze, the formation of blisters is enhanced by too thick glaze layers or too high surface tension or viscosity.

Mistakes during firing also increase the formation of blisters: too high temperature, a reductive kiln atmosphere at the beginning, too short firing cycles or too short soaking times. The kiln should be well ventilated at all times.

Matt Stains, Glossy Areas and Discolourations

One can distinguish between matt areas in a glossy glaze and glossy areas in a matt glaze. Additionally, discolourations or traces on fired pieces may occur.

There are several reasons for matt stains. Among them are inhomogenous glaze applications or too low firing temperatures. The evaporation of fluxes, e.g. lead, during firing leaves no damage if the ventilation flaps of the kiln are left open. If there is excess water during heating, a good ventilation also helps.

Glossy areas often are caused by too thin glaze layers or temperatures that are too high. The kiln atmosphere may be improved by sufficient air supply while heating and slow cooling.

Discolourations often are formed by evaporated metal oxides, which were added to the glaze in pure form or as part of a colour stain, e.g. chromium, copper or cobalt oxide. If the evaporation is very high without proper ventilation, even tiny crystals may occur. Only a sufficient ventilation of the kiln may solve the problem.

Glaze Properties

Product no.	Type	% PbO	C.T.E. [10 ⁻⁷ /K]	Tableware/ earthenware	Tableware/ stoneware	Art ceramics/ stove tiles	glossy	matt	Firing temperature °C
VTR 40 539 F	transparent glaze	0	61	x		x	x		1040 - 1100
VTR 166	transparent glaze	0	56	x		x	x		1040 - 1100
VTR 40 660 F	transparent glaze	0	60	x		x	x		1000 - 1150
VTR 320	transparent glaze	0	62	x			x		920 - 980
VTR 102	transparent glaze	0	64	x		x	x		980 - 1070
VTR 209	transparent glaze	0	61	x		x	x		980 - 1050
VTR 40 271 TM	transparent glaze	0	60	x		x	x		1060 - 1100
VTR 105	transparent glaze	0	56	x	x	x	x		1040 - 1100
DV 14214A	bone china glaze	0	63				x		1040 - 1120
DV 14214B	bone china glaze	0	65				x		1040 - 1120
DV 14215A	bone china glaze	0	77				x		1040 - 1120
DV 14215B	bone china glaze	0	73				x		1040 - 1120
VTR 40 5245 F	transparent glaze	14	55	x		x	x		1040 - 1080
VTR 40 134 F	transparent glaze	39	52			x	x		950 - 1040
VTR 17	transparent glaze	43	54			x	x		950 - 1040
VTR 39	transparent glaze	2	60	x		x	x		980 - 1020
VTR 40 610 F	transparent glaze	43	54	x	x	x	x		1000 - 1150
VTR 40 525 F	matt glaze	0	57	x		x		x	1020 - 1100
VTR 40 545 TM	matt glaze	0	62	x		x		x	1020 - 1080
VTR 40 287 TM	matt glaze	0	61			x		x	1040 - 1120
FCM 61094	matt glaze	19	55			x		x	1040 - 1100
VBC 49 7654	opaque glaze	0	55	x			x		980 - 1050
VBC 13	opaque glaze	0	58	x		x	x		980 - 1060
VBC 142	opaque glaze	0	67	x			x		920 - 980
VBC 43 554 TM	effect glaze	0	62	x		x		x	1020 - 1140
VBC 43 556 TF	effect glaze	0	65	x		x		x	1020 - 1080
VBC 46 233 TM	effect glaze	0	83	x		x	x		980 - 1100
VBC 49 485 TM	effect glaze	0	65	x		x		x	1000 - 1100
VBC 49 872 TM	effect glaze	0	58	x		x		x	1000 - 1080
VTR 40 581 E	stoneware glaze	0	59		x		x		1190 - 1260
VTRS 115	stoneware glaze	0	66		x		x		1150 - 1200

The information and statements contained herein are provided free of charge. They are believed to be accurate at time of publication, but Ferro makes no warranty with respect thereto, including but not limited to any results to be obtained or the infringement of any proprietary rights. Use or application of such information or statements is at user's sole discretion, without any liability on Ferro's part. Nothing herein shall be construed as a license of or recommendation for use that infringes upon any proprietary rights. All sales are subject to Ferro's General Conditions of Sale and Delivery.